


Subject: <p style="text-align: center;">DIRT ACCUMULATION ON SIDE SILL</p>	Bulletin No: 09-044/06
	Last Issued: 11/03/2006

APPLICABLE MODEL(S)/VINS

2007 CX-7 vehicles with VINs lower than JM3ER****7*138083 (produced before September 11, 2006)

DESCRIPTION


On some vehicles, dirt or debris may accumulate on the side sill and get the customer's clothing dirty when they enter or exit the front or rear doors of the vehicle.

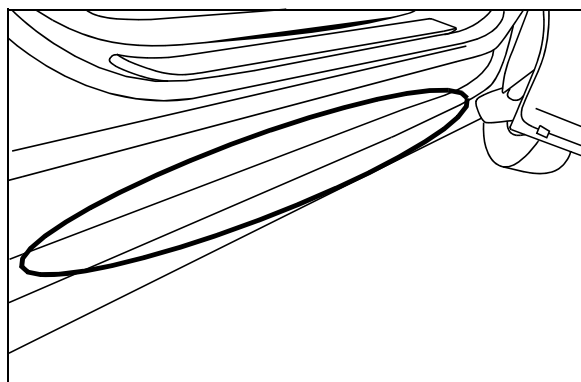

1720a

Due to the shape of the rubber seal attached to the side step, dust may easily enter the side sill area and accumulate there.

The shape of the rubber seal has been changed during mass-production.

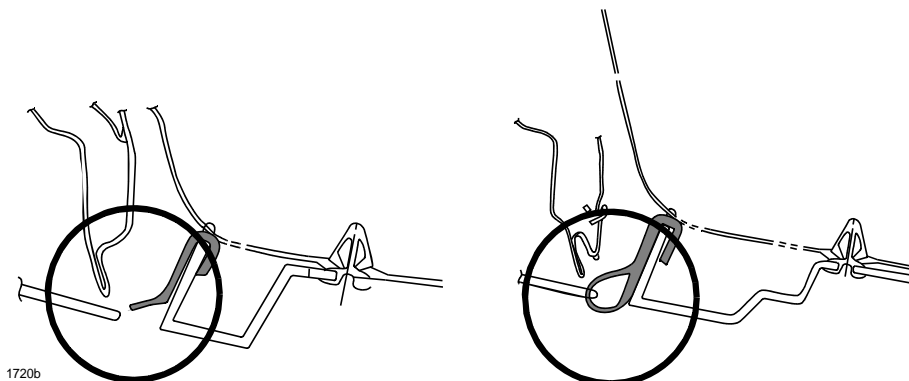

1720b

CURRENT TYPE

NEW TYPE

Customers having this concern should have their vehicle repaired using the following repair procedure.

Bulletin No: 09-044/06 © 2006 Mazda Motor of America, Inc.	Last Issued: 11/03/2006
--	--------------------------------

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace both left and right side steps with modified parts.
NOTE: Side step covers front and rear door side sill areas.
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
EG51-51-P40	Side Step (R)	1
EG51-51-P50	Side Step (L)	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	98
Damage Code	97
Part Number Main Cause	EG51-51-P40
Quantity	1
Operation Number / Labor Hours:	XXB436RX / 0.5 Hrs (both sides)